

27



TIFFIN AIRE INC.

**3861 Co. Rd. 140
Findlay, Ohio 45840
1-800-553-7767
Fax 419-299-3244**

Propeller Log Book

Stack
Owner Name

Shettel Aviation

Address

Business Airport of Carlisle, Petersburg Rd.
Carlisle, Pa 17013

Propeller Make

Hartzell

Propeller Model

HC-E2YR-2 RBSF

Blade Model

F8465B-7R

Hub Serial No.

BP 7590

Blade Serial No. 1

C44226

2

D41242

3

—

4

—

PITCH RANGE

High

20.4°

Low

15.2-14.5°

Feather

79.7°

Reverse

Maximum Hours or Service Life between overhaul required by Mfg.

2000

Hrs. or

5

years interval between overhauls.

SERVICEABLE

PROPELLER UNIT MCCAULEY
MAKE

HC-E2YR-2RBSF BP 7590
MODEL SERIAL NUMBER

The component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service.

Pertinent details of the repair are on file at this repair station under:

STOCK

OWNER SHETTEL AVIATION

WORK ORDER NO. 13110

DATE 05/30/97

[Signature] SIGNED FOR

Tiffin Aire Inc.
3861 Country Road 140
Findlay, Ohio 45840
419-299-3562
800-553-7767
FAX 419-299-3244

F.A.A. Repair Station Number IC5R930M

Work Performed by _____
Repair Station #IC5R930M. Work Order/Invoice # _____

Signatures
and Station
Numbers

MAINTENANCE & SERVICE HISTORY

Signatures
and Station
Numbers

Date 05/30/97

Propeller Total Time UNKNOWN

Tach/Hobbs Time UNKNOWN

Propeller Time Since Overhaul -0-

COMPLETELY OVERHAULED PROPELLER ASSEMBLY IN ACCORDANCE WITH HARTZELL SERVICE MANUAL #117D. STRAIGHTENED BOTH BLADES. SHOT PEENED (2) BEARING HUB SEATS. COMPLIED WITH SERVICE BULLETIN #213. COMPLIED WITH SERVICE LETTERS 177,61T,69,82A,101A,148A,154,155A.

COMPLIED WITH SERVICE BULLETINS 118D,136H,142B,159A,213,224R1,226R1.

COMPLIED WITH A.D. NOTES 71-21-09,77-12-08. END.

Work Performed By Tiffin Aire Inc.

Repair Station #IC5R930M. Work Order/Invoice # 13110

Signature



MAINTENANCE & SERVICE HISTORY

Date Tot

Date 09/24/97

Propeller Total Time UNKNOWN

Tach/Hobbs Time UNKNOWN

Propeller Time Since Overhaul 0.0

INSTALLED 2 NEW B.F.G. 4E1188-3 DE-ICERS IN ACCORDANCE
WITH HARTZELL ALUMINUM BLADE OVERHAUL MANUAL #133C.

INSTALLED 2 NEW TY527M TY-RAPS AND 1 NEW CAU113 DECAL.

Work Performed By Tiffin Aire Inc.

Repair Station #IC5R930M. Work Order/Invoice # _____

Signature _____

END.

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
4/2/99	1268.8 Hobbs	198.0 Hrs.	Serviced propeller w/ Aeroshell 6 grease. No leaks noted. I certify that this aircraft propeller has been inspected in accordance with an annual inspection and was determined to be in airworthy condition. END	Cresoy J. Shaw AIP 282744266 IT.
2/1/00	1472.6	A/C Hobbs	C/W Annual Inspection Greased & Lubed	Reproduction ATR 135X

J&J Aviation Inc.
2900 Bobmeyer Road
Hamilton, Ohio 45015

Hartzell

Date 3-28-2001

N600MP

HC-E2YR-2RBSF

 
SN: BP7590

SPOH: 620.2 Hrs

Hobbs 1691.0 Hrs

Right Prop

Completed an Annual Inspection of this aircraft propeller on this date. Greased prop with Aeroshell #6 grease and serviced prop dome with nitrogen. I certify that this aircraft propeller has been inspected in accordance with an Annual Inspection and was determined to be in airworthy condition. -END-


 Jeffrey J Whyte I.A.297760788

