



The Standard




ENGINE LOG

ASA-SE-1

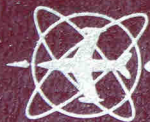

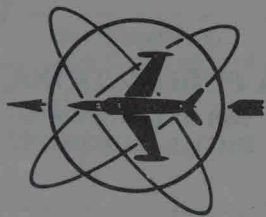

MODEL SE-1

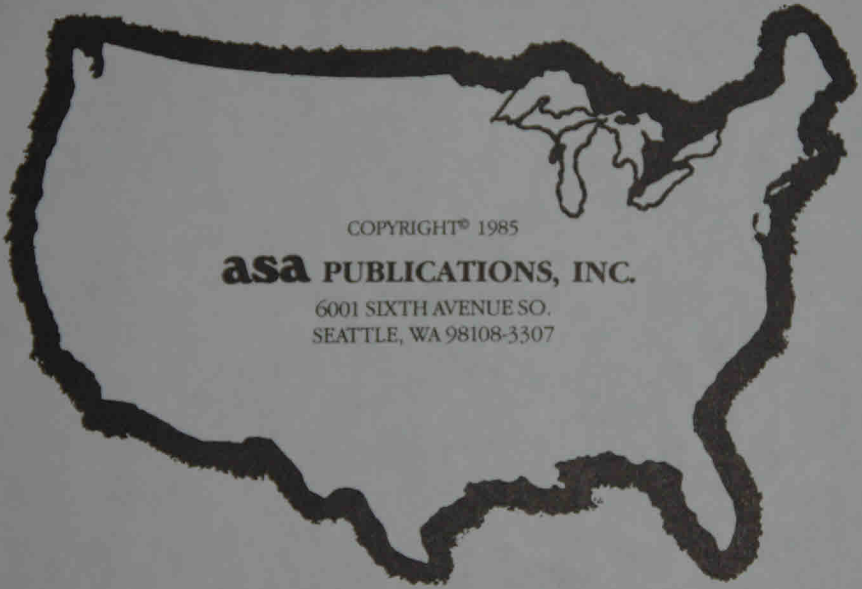

COPYRIGHT® 1985

asa PUBLICATIONS, INC.

6001 SIXTH AVENUE SO.
SEATTLE, WA 98108-3307

ENGINE RECORD — GENERAL INFORMATION

MANUFACTURER Wright MODEL R 760-8

SERIAL 6399 TYPE CERTIFICATE _____

THIS ENGINE IS CURRENTLY INSTALLED IN AIRCRAFT _____


MINIMUM OCTANE FUEL _____ OIL GRADE SUMMER _____ WINTER _____

MAGNETO TIME _____ POINT SETTING _____ FIRING ORDER _____

SPARK PLUG GAP _____

MFG. RECOMMENDED OVERHAUL AT _____ HOURS.

The Standard

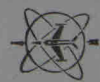

ENGINE LOG

REGISTERED OWNER RECORD

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NAME _____ ADDRESS _____

CITY _____ STATE _____ FROM _____ TO _____

NOTES

Make repairs to

The above information should be used
as a guide only. It is not intended
to be used as a substitute for the
instructions in the FAA approved
repair manual for this aircraft.

For detailed information on the
repair station work order and its
contents, refer to the FAA approved
repair manual for this aircraft.

Date

Inspected by

Signature

BAIKE CONNOR AIRCRAFT REPAIR
8812 AIRPORT BLVD
LEESBURG, FL 34748
PHONE (888) 787-8881

CERTIFIED REPAIR STATION FAA APPROVED NO. V83800M

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
8/2				Installed engine with new mount bolts, mount sandblasted and magna fluxed, welded cracks, primed and painted with Incon, starter inspected and clutch set by Aero engines, see yellow tag, serviced with AeroShell 140 Non detergent oil, test ran, no leaks found. Donald B. Toney IA/99484/87 (end)
3/8/91				Changed oil, cleaned filter, serviced with 100w AeroShell Detergent oil. Inspected engine 3/8/91 on Annual inspection ADI checked to date.
TTAF	3568.8			Annual inspection and was determined to be in airworthy condition. IA/99484/69 Date 3/8/91 Donald B. Toney

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	DESCRIPTION OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS ENTRIES MUST BE ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF MECHANIC OR REPAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)
19 <u>90</u>				Maintenance Release
4-25-90		T.T. App. 1500.00		The aircraft, airframe, aircraft engine, propeller or appliance identified below was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service.
				Pertinent details of the repairs are of file at this repair station under work order # <u>3177</u>
				Dated <u>4-25-90</u>
				Inspected By <u>[Signature]</u>
				Cert. # <u>VB4R590M</u>
				<p>MIKE CONNOR AIRCRAFT REPAIR 8812 AIRPORT BLVD. LEESBURG, FL 34788 PHONE (904) 787-8331</p>
				CERTIFIED REPAIR STATION FAA APPROVED NO. VB4R590M
				<p>This engine overhauled as per weight overhaul manual using new Pistons Rings, Piston Pin, Fresh Chrome Cylinders, new Thrust, Fuel and Rocker Main Bearings, new exhaust valves. All use Volvo.</p>
				Cords, Rewired sparkplug Ignition Harness, WABs, overhauled by
				Drew #4534. Excavator Disassembled
				and cleaned new baskets and seals installed
				Float level checked, engine
				TEST Run OK. USE MANUAL OIL FOR BREAK IN.

